

*ISSN Print: 0976-6308*

*ISSN Online: 0976-6316*

*<http://www.iaeme.com/ijciyet/index.asp>*

***International Journal  
of  
Civil Engineering & Technology  
(IJCIET)***



*IAEME Publication*

*Plot : 03, Flat- S 1,*

*Poomalai Santosh Pearls Apartment*

*Plot No. 10, Vaiko Salai 6th Street*

*Jai Shankar Nagar, Palavakkam, Chennai- 600 041*

*Tamilnadu, India*

## EDITORIAL BOARD

### Chief Editor

Dr. **Kadhim Naief Kadhim** College of Engineering, Babylon University, IRAQ

### Managing Editor

Dr. **H.T.Basavarajappa** Department of Studies in Earth Science, University of Mysore, India

### Associate Editors

Dr. **V.Antony Joe Raja** Sri Muthukumaran Institute of Technology, India

Prof. **B. Arthi Gandhimathi** IAEME Publication, India

Dr. **N. Tamil Selvan** IAEME Publication, India

Er. **D. S. Chengalvarayam** IAEME Publication, India

### Copy Editors

Mr. **K.Prasanth** IAEME Publication, India

Mr. **T.Nagarajan** IAEME Publication, India

### Editorial Board

Dr. **Mariappan.P** TWAD BOARD, India.

Dr. **Saleh Abd El-Aleem Mohammed El-Awney** Fayoum University, Fayoum, Egypt.

Dr. **Yongwei shan** Oklahoma state university, USA.

Dr. **Pei tang** JCMS, Inc- Mercerville, USA.

Dr. **Najm alghazali** Babylon University, IRAQ.

Dr. **Moises diaz-cabrera** University of Las Palmas de Gran Canaria, Spain.

Dr. **Cristina T. Coquilla** PIMSAT Colleges Dagupan City, Philippines.

Dr. **Ammar Al-Ojaili** Higher College of Technology / Muscat, Sultanate of Oman.

Dr. **Mohsen Sherif** College of Engineering, UAE University, UAE.

Dr. **Alireza bahrami** Islamic Azad University-Ahvaz Branch, Iran.

Dr. **Fred Boadu** Duke University Durham, USA.

Dr. **Mirko Mazza** Università della Calabria, Italia

Dr. **Taha Ibrahim** Benha University, Egypt

Prof. **Ragab Megahed Abd El-Naby** Benha University, Egypt

Prof. **Fabio Mazza** University of Calabria, Italy

Dr. **Ali Akbar Firoozi** Universiti Kebangsaan Malaysia, Malaysia

Dr. **Wilson Udo Udofia** University of Uyo, Nigeria

Er. **Behnaz H. Zaribaf** Georgia Institute of Technology, Atlanta, GA, USA

Dr. **Srijit Biswas** Manav Rachna International University, Faridabad, India

Dr. **PL Meyyappan** Kalasalingam University, India

Prof. **Anne Mary J** Vel Tech Dr. RR & Dr. SR University, Chennai,

Dr. **Vikas Srivastava** Sam Higginbottom University of Agriculture Tech & Sciences, UP-India

Dr. **A.Siva Sankar** KL University, India

Dr. **P. Perumal** Vignan University, India

Prof. **Gloria Terenzi** University of Florence, Italy

Dr. **A. Vijayakumar** GMR Institute of Technology, Rajam, Andhara Pradesh, India

Dr. **Satish kumar Moparhi** Kallam Haranadha Reddy Institute of Technology, Andhra pradesh, India

Dr. **N.Sivakumar** SSN College of Engineering, Tamilnadu, India

Dr. **Dr. Babu Rao Gudipudi** Narasaraopeta Engineering College, Andhra Pradesh, India

Dr. **Mattia Rapa** Sapienza University of Rome, Italy

Dr. **Valentine Yato KATTE** Higher Technical Teacher Training College (HTTTC) Bambili, Cameroon

Dr. **Komal P.Mehta** ITM, Universe, Vadodara, Gujarat, India

Prof. **Aamer Najim Abbas** Mustansiriyah University/College of Engineering/Water Resources Engineering Department, Iraq

## Reviewer Board

Dr. <b>Ajit Kumar</b>	Indira Gandhi National Open University (IGNOU), New Delhi, India
Dr. <b>S. Robert Ravi</b>	PSR Engineering College, Tamil Nadu, India
Dr. <b>Syed Anisuddin</b>	Caledonian College of Engineering, Sultanate of Oman
Dr. <b>K. Ramu</b>	JNTU College of Engineering, Kakinada, India
Dr. <b>Anant Parghi</b>	S.V. National Institute Of Technology, Gujarat, India.
Er. <b>Sadam Hade Hussein</b>	Universiti Tenaga Nasional, Malaysia
Dr. <b>P.Muthupriya</b>	Sri Krishna College of Technology, Coimbatore
Prof. <b>Anuj Chandiwala</b>	Chhotubhai Gopalbhai Institute of Technology Gujarat, India
Er. <b>Ali Amer Karakhan</b>	University of Baghdad, Iraq
Dr. <b>S.Bhagavathi Perumal</b>	R.M.K.College of Engineering and Technology, Tamilnadu, India
Dr. <b>Sujatha Unnikrishnan</b>	Christ Deemed to be University, Bangalore, India



Bibliometrics	
Download (3 Weeks)	:
Download (6 Weeks)	: 499
Download (6 Months)	: 1243
Download (1 Year)	: 1463

S.No	Article ID	Title of the Paper	Authors	Pages	Downloads	How to cite this article
1	IJCIET_08_12_001	<a href="#">RELATIVE ANALYSIS OF MCX ENERGY AND MCX METAL INDEX</a> <a href="#">Download</a> PDF Abstract Reference	D. ARPANA and Dr. M. NANDHINI	1 - 11	101	<a href="#">View</a>
2	IJCIET_08_12_002	<a href="#">MEDICAL GARBAGE SOIL AND ITS NEUTRALIZATION BY COWDUNG</a> <a href="#">Download</a> PDF Abstract Reference	S. ANBUSELVI, PRIYANGA K, ALBENNA REJI and JYOTI KUMARI BHAGAT	12 - 16	68	<a href="#">View</a>
3	IJCIET_08_12_003	<a href="#">ESSENCE OF POUNDING GAPS IN SEISMIC ZONE IV AND V WITH &amp; WITHOUT SHEAR WALLS</a> <a href="#">Download</a> PDF Abstract Reference	BOLEM PAVAN KUMAR, CHANDAN KUMAR PATNAIKUNI, BALAJI.KVGD and B SANTHOSH KUMAR	17 - 26	37	<a href="#">View</a>
4	IJCIET_08_12_004	<a href="#">DEVELOPING IMPROVEMENT OF AUDITOR'S PERFORMANCE MODEL USING PROFESSIONAL SKEPTICISM AND AUDITORS' COMFORT AS A MEDIATOR</a> <a href="#">Download</a> PDF Abstract Reference	LISMAWATI, ABDUL ROHMAN, ANIS CHARIRI	27 - 37	23	<a href="#">View</a>
5	IJCIET_08_12_005	<a href="#">DEVELOPMENT OF AN EFFICIENT EPILEPSY CLASSIFICATION SYSTEM FROM EEG SIGNALS FOR TELEMEDICINE APPLICATION</a> <a href="#">Download</a> PDF Abstract Reference	HARIKUMAR RAJAGURU and SUNIL KUMAR PRABHAKAR	38 - 52	16	<a href="#">View</a>
6	IJCIET_08_12_006	<a href="#">AN INSIGHT TO BREAST CANCER CLASSIFICATION WITH ANT COLONY SYSTEM ALGORITHM</a> <a href="#">Download</a> PDF Abstract Reference	HARIKUMAR RAJAGURU and SUNIL KUMAR PRABHAKAR	53 - 59	12	<a href="#">View</a>
7	IJCIET_08_12_007	<a href="#">PERFORMANCE ANALYSIS OF LOGISTIC REGRESSION AND KERNEL LOGISTIC REGRESSION FOR BREAST CANCER CLASSIFICATION</a> <a href="#">Download</a> PDF Abstract Reference	HARIKUMAR RAJAGURU and SUNIL KUMAR PRABHAKAR	60 - 68	17	<a href="#">View</a>
8	IJCIET_08_12_008	<a href="#">ENHANCED ATTACK RESISTANT AGENT BASED DYNAMIC KEY MANAGEMENT IN DYNAMIC WIRELESS SENSOR NETWORKS</a> <a href="#">Download</a> PDF Abstract Reference	RIAZ SHAIK, SHAIK SHAKEEL AHAMAD	69 - 76	19	<a href="#">View</a>

S.No	Article ID	Title of the Paper	Authors	Pages	Downloads	How to cite this article
101	IJCIET_08_12_101	<a href="#">SLAG THE BEST OPPORTUNITY TO SAVE NATURAL RESOURCES</a> <a href="#">Download</a> <a href="#">PDF</a> <a href="#">Abstract</a> <a href="#">Reference</a>	ISHFAQ AHMAD BHAT and ER. PUNEET SHARMA	931 - 936	27	<a href="#">View</a>
102	IJCIET_08_12_102	<a href="#">QUALITY IMPROVEMENT OF WATER RESOURCES BY REMOVAL OF MERCURY AND LEAD CONTAMINANTS THROUGH FORWARD OSMOSIS (FO) TECHNOLOGY WITH VIBRATING MEMBRANE</a> <a href="#">Download</a> <a href="#">PDF</a> <a href="#">Abstract</a> <a href="#">Reference</a>	MAJID MESCHI NEZAMI and MOHAMMAD-JAWAD KHANJANI	937 - 950	22	<a href="#">View</a>
103	IJCIET_08_12_103	<a href="#">THE FLEXURAL BEHAVIOR OF STEEL TUBE FILLED WITH PVA FIBER-REINFORCED CEMENT COMPOSITES INCORPORATING RECYCLED MATERIALS</a> <a href="#">Download</a> <a href="#">PDF</a> <a href="#">Abstract</a> <a href="#">Reference</a>	HYUN-DO YUN, WAN-SHIN PARK, YOUNG-IL JANG and SUN-WOO KIM	951 - 960	11	<a href="#">View</a>
104	IJCIET_08_12_104	<a href="#">RELIABILITY STUDY OF HOSPITAL BUILDING IN MATARAM CITY AGAINST FIRE HAZARD</a> <a href="#">Download</a> <a href="#">PDF</a> <a href="#">Abstract</a> <a href="#">Reference</a>	S. ANWAR, AKMALUDDIN and HARIYADI	961 - 968	14	<a href="#">View</a>
105	IJCIET_08_12_105	<a href="#">CHARACTERIZATION OF GROUND PROFILE USING MULTICHANNEL ANALYSIS OF SURFACE WAVE AT SOMNATH TEMPLE</a> <a href="#">Download</a> <a href="#">PDF</a> <a href="#">Abstract</a> <a href="#">Reference</a>	SHIVAMANTH ANGADI, MAYANK K. DESAI, CHANDRESH H. SOLANKI and GOUDAPPA R. DODAGOUDAR	969 - 976	9	<a href="#">View</a>
106	IJCIET_08_12_106	<a href="#">COMPARISONS OF BRIDGE PIER MODELS FOR REDUCING LOCAL SCOUR USING METALLIC PLATES.</a> <a href="#">Download</a> <a href="#">PDF</a> <a href="#">Abstract</a> <a href="#">Reference</a>	A. P. TALATKAR, N. P. PATKI, V. P. WAGH and A. A. SHAIKH	977 - 985	11	<a href="#">View</a>
107	IJCIET_08_12_107	<a href="#">A STUDY OF GREEN BUILDING PROSPECTS ON MANAGEMENT DECISION MAKING WITH REFERENCE TO DELHI NCR REGION</a> <a href="#">Download</a> <a href="#">PDF</a> <a href="#">Abstract</a> <a href="#">Reference</a>	RAJNI RATHI and SANJEEV BANSAL	986 - 999	9	<a href="#">View</a>
108	IJCIET_08_12_108	<a href="#">BUFFERING CAPACITY AS AN INDICATOR OF THE CARIOGENIC POTENTIAL</a> <a href="#">Download</a> <a href="#">PDF</a> <a href="#">Abstract</a> <a href="#">Reference</a>	SHANTHI KIRAN PAIS, RONALD MENEZES, BAKRUDEEN ALI AHMED, MUKESH GOEL, ASHUTOSH DAS	1000 - 1007	5	<a href="#">View</a>



# RELIABILITY STUDY OF HOSPITAL BUILDING IN MATARAM CITY AGAINST FIRE HAZARD

**S. Anwar\*, Akmaluddin, and Hariyadi**

Postgraduate Study Program of Civil Engineering, University of Mataram,

Jl. Majapahit no. 62, Mataram, NTB, 83125, Indonesia

\*E-mail: [baimgilang@gmail.com](mailto:baimgilang@gmail.com)

## ABSTRACT

*Construction work usually only takes into account structural strength technically regardless of non-technical elements such as fire safety inspection systems. Therefore, the provision of fire protection equipment to maintain the service life of the building becomes dormant. Fire incidents always cause losses in the form of properties and casualties and their impact on the reduced service life of the building. Hospital buildings have a high fire risk. Fire on hospital buildings has a huge impact because they are a vital object as health service. The purpose of this study is to know the application of fire prevention system and reliability level of a hospital building in Mataram City.*

*The hospital buildings under study were the General Hospital of West Nusa Tenggara Province (RSUP) and Graha Ultima Medika Hospital (RSGUM). To find out the application of fire prevention system at the buildings, the descriptive method was used. Then the results obtained were analyzed using a Likert scale. Meanwhile, to know the reliability of the buildings, the method used was descriptive-quantitative based on the Regulation Pd-T-11-2005-C on Building Fire Safety Inspection.*

*The results show that the regulation implementation values of safety equipment and passive protection system in RSUP are 4.18 and 2.71 respectively. Meanwhile, in RSGUM, the regulation implementation values of 3.63 and 3.0 for safety equipment and the passive protection system respectively are obtained. Therefore, it can be concluded that the implementation of safety regulations and passive protection system at RSUP is better than that of RSGUM. Moreover, utility component assessment in RSUP and in RSGUM produced values of Reliability of Building Safety System of 73.27% and 67.82% respectively. This indicates that RSUP building is more reliable than the building of RSGUM.*

**Key words:** Building, fire protection system, reliability, safety system.

**Cite this Article:** S. Anwar, Akmaluddin and Hariyadi, Reliability Study of Hospital Building in Mataram City Against Fire Hazard. *International Journal of Civil Engineering and Technology*, 8(12), 2017, pp. 961-968.

<http://www.iaeme.com/IJCIET/issues.asp?JType=IJCIET&VType=8&IType=12>

## 1. INTRODUCTION

The hospital is one of the buildings that have a high risk of fire disaster. Hospital fires in addition to being triggered by short-circuiting electrical currents can also be triggered by the use of electrical equipment, the use of pressurized gas cylinders, as well as the use of flammable, corrosive, and harmful chemicals. A large number of potential sources of fire hazards makes hospitals a relatively high risk of fire, according to the National Fire Protection Association (NFPA). The main cause of casualties in any fire is not caused by fire alone but by inhaling toxic fumes and fumes. In many cases of fire incidents, casualties also occur in rooms and floors that are different from the location of fire, especially on floors and rooms located above the scene of the fire.

In 2011, a fire incident took place at the NTB Provincial Public Hospital killing one patient and burning 17 poly rooms. In March 2016 there was also a fire at Mintoharjo Naval Hospital that killed four people, which, according to the results of the investigation, the fire incident was caused by short-circuiting electricity in the tube room at the High-Pressure Air Space Building. The same incident also occurred towards the end of 2016 ie the fire that occurred at the Hospital Cement Gresik caused by an electric wheelchair. Fire incident is a lesson for us to always anticipate the potential for fire hazards in buildings, especially in hospital buildings.

In the city of Mataram, there are several hospitals consisting of various types of national to international standards such as Risa Hospital, Harapan Keluarga Hospital, Graha Ultima Medika Hospital, Mataram City General Hospital and General Hospital of West Nusa Tenggara Province. The above hospitals are almost all located in the middle of residential areas, even Graha Ultima Medika Hospital, its location is directly adjacent to the gas station in Majapahit Street so this certainly endangers the existence of the hospital. Law No.28 of 2002 [1] defines that the building is a physical form of the result of a construction that is united with its place of position, partly or wholly located above and/or in the soil and / or water, which functions as a place for human to perform activities, or residence, religious activity, business activity, social activities, culture, as well as special activities and utilization shall be in accordance with predetermined functions, including periodic maintenance, maintenance and inspection activities.

Ramli [2] defines fire as a natural condition due to the uncontrolled meeting of fuel, oxygen, and heat. The three elements above are the cause of the fire, if one of the three elements is not met then there is no fire. According to Triyono [3], fire incidents occur due to various things such as human, natural events, ignition itself and due to intentional factors. While based on data compiled by the National Fire Protection Association (NFPA) in 2005 as shown in Table 1, it is mentioned that the causes of the fire incident and the incidence of occurrences, especially the fire that occurred in hospital buildings are as follows:

**Table 1** Causes of fire in hospitals (NFPA, 2005)[4]

Special category	Event number (%)
Related to cigarettes	32.0
Sabotage	13.8
Faulty equipment	10.0
Electrical distribution system	8.0
Lighters, light, and combustion in the open area	6.1
Dryer	3.6
AC (refrigeration)	2.6
Room heater	2.0
Electrical equipment (X-rays, computers, phones)	1.7

Generator	1.3
incinerator	1.1
TV, radio, machine fax	0.8
Biological equipment	0.5
Elevator	0.1
Other tools	2.5
Other equipment	2.1
Another unknown cause	10.3

According to Pd T-11-2005-C on Fire Building Safety Inspection [5], utility components include: (1) completeness of the footprint, its component is water source, road environment, and hydrant yard; (2) rescue plan, its component is the way out and its construction; (3) active protection system, its components are fire detection and alarm, seams connection, light fire extinguisher, building hydrant, sprinkler, extinguishing system, smoke controller, smoke detection, smoke exhaust, fire elevator, emergency light, emergency power, and control room operation; (4) passive protection system, its components are the completeness of the site/ footprint, the components of the rescue tool, fire resistance and stability, compartmentalization of space, and the protection of openings.

According to Saptaria and Erry et al. [6], the value of the reliability condition of the building safety system is the value of the building or building utility showing the best condition, functioning optimally or whether it is appropriate or not with the specified requirements. The steps of building safety inspection are as follows: (1) provide assessment of all sub parameters of building safety system reliability based on field observations; (2) calculate the condition value of all sub parameters available; (3) calculate the value of the reliability condition of the building safety system by summing the condition values of all sub parameters into the building safety system; (4) calculate the reliability of the building safety system against fire hazard by adding 4 components of fire protection system in the building structure i.e. building site, rescue device, passive protection system and active protection system.

## 2. RESEARCH METHOD

Stages of analysis conducted in research Assessment Application of Rescue Equipment and Passive Protection System is to determine the variable for data retrieval. Data collection is done by doing direct observation in the field. The results of these observations are then analyzed using the Likert scale which is used as the value of the scale of conformity measurement between two or more components reviewed.

**Table 2** Likert scale, Sugiyono [7].

No.	Explanation	Likert scale
1.	In line with the rules	5
2.	In accordance with the rules	4
3.	Sufficient according to the rules	3
4.	Lack of rules	2
5.	Very unfulfilled	1

To get the final result of each component, the average formula can be used:

$$X = \frac{x_1 + x_2 + \dots + x_n}{n} \tag{1}$$

Where X is the average value of each component,  $x_1, x_2, \dots, x_n$  are the sum of the values, n the number of data.

Based on the regulations issued by Balitbang PU Pd-T-11-2005-C concerning fire inspection of building fire [5], reliability is the level of perfection of the condition of the protective equipment that ensures the safety, functionality and comfort of a building and its environment during the life of the building in terms of the danger of fire, while the safety of the building is a condition that ensures safety and disaster prevention in a building and its contents (human, equipment, goods) caused by failure or malfunction of building utilities. Referring to technical guidance issued by Balitbang PU Pd - T - 11 - 2005 - C [5], the assessment is based on criteria or restrictions on the condition of building components. The value of the condition of the fire protection component of the building is divided into three levels, namely: GOOD = "B", MIGHT or ENOUGH = "C", and LESS = "K", Equivalence value B is 100, C is 80 and K are 60 as described in Table 3 below:

**Table 3** Level of fire audit assessment

Value	Conformity	Reliability
> 80 - 100	As per the requirement	Good (B)
60 - 80	Installed but there is a small installation that does not meet the requirements	Enough (C)
< 60	It is not accordance with	Less (K)

Based on Regulation Pd - T - 11 - 2005 - C, the weighting on each component must be done by Analytical Hierarchical Process (AHP) method, where the result of weighting parameter of building safety system components as according to the above rule is shown in Table 4:


**Table 4** Results of parameter weighing components of building safety systems

No.	Parameter KSKB	Weigh KSKB (%)
1	Tread Completeness	25
2	Rescue Facility	25
3	Active Protection System	24
4	Passive Protection System	26

Source: Regulation Pd - T - 11 - 2005 - C [5]

In this study, the method used is: (1) descriptive method, to know the application of rescue and passive protection system to fire hazard through direct observation at research location based on Regulation of Minister of Public Works No.26 / PRT / M / 2008 [8] for further analysis based on Likert scale; (2) descriptive-quantitative method, to determine the reliability of the building safety system against fire hazard through direct observation based on Regulation Pd - T - 11 - 2005 - C on fire building fire inspection, which includes: (a) site completeness component; (b) component of the means of rescue; (c) passive protection system components; (d) active protection system components that affect the passive protection system.

The study began in July 2017 by taking research sites at public and private hospitals. The object of research is the General Hospital of West Nusa Tenggara Province (RSUP) and Graha Ultima Medika (GUM) Hospital as in Figure 1.

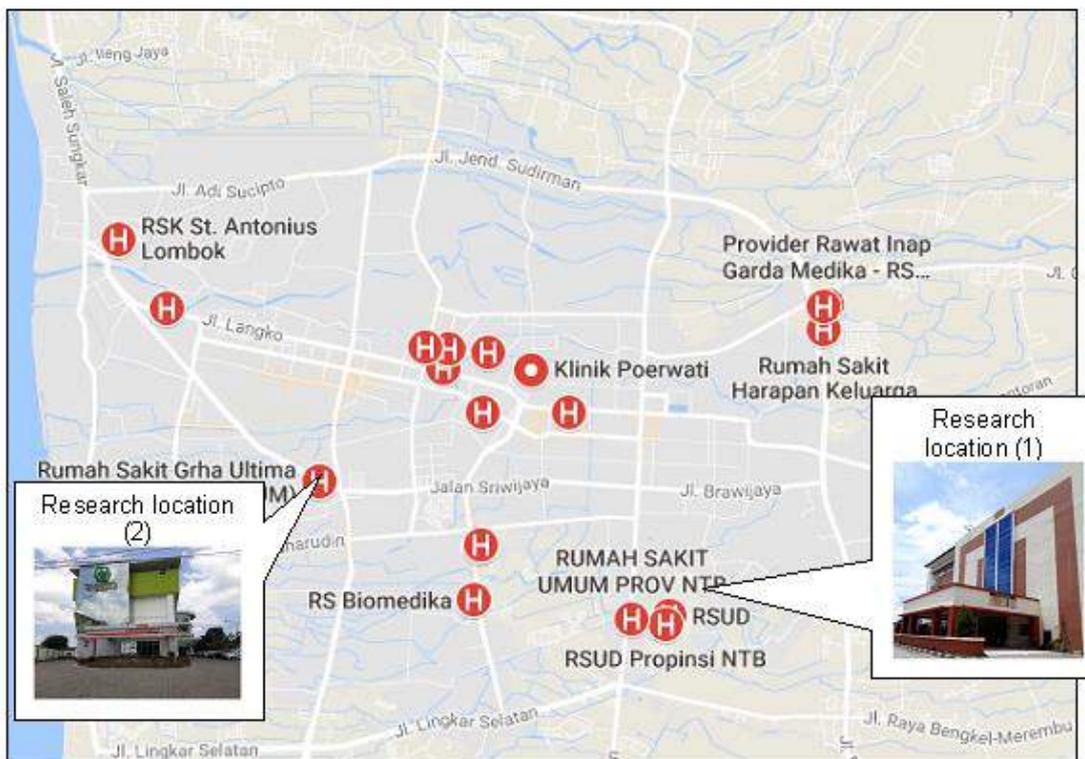

**Figure 1** Location of RSUP and GUM hospitals.

Data collection techniques in this study are to use 2 methods, namely by collecting primary and secondary data directly related to the research objectives to be achieved. Primary data collection is in the form of primary data obtained directly based on the results of observation and documentation directly at the study site. The data is in the form of condition of building rescue system component to fire hazard covering component of site completeness, rescue device, passive protection system and active protection system. To add the source of information about building safety system of the 4 hospitals above against fire prevention, the secondary data is divided into 2, namely: (1) secondary data in the form of literature and legislation obtained from several regulations, such as Regulation of the Minister of Public Works No.26 / PRT / M / 2008 [8] and Pd-T-11-2005-C [5] concerning Fire Inspection of building fire; (2) secondary data for the examination of reliability in fire prevention on the object of study obtained from the building manager as the responsible executor, covering the drawing of the hospital building plan, the accomplished picture (As Built Drawing) and other sources of information needed in the examination of the reliability of building system buildings against fire hazards.[9]

Data obtained from direct observation and check list in the field are used to find out the application of rescue facilities against fire hazard as written in [8], and the reliability value of building safety systems against fire hazard under regulation [5]. The results of the next observation are analyzed by Likert scale, ie the scale used for the measurement of conformity between two or more components reviewed. After the assessment of the condition of the building is done, then it can provide recommendations for conducting repair or rehabilitation system in order to obtain good building reliability.

### 3. RESULTS AND DISCUSSION

Based on the observation in the field, the value of implementing the Rescue Facility rules can be obtained and shown in Tables 5 and 6:

**Table 5** Results of analysis of rescue equipment rules in Likert scale

No.	Reviews	Likert scale	
		RSUP	GUM
1	Exit	5	5
2	The reliability of exit	4	5
3	Doors	5	2
4	Protected spaces and stair protection	2	1
5	The exit canal	5	5
6	Number of exits	5	3
7	The arrangement of exits	4	4
8	Exit release	3	5
9	Illumination of means of exit	5	5
10	Emergency lighting	3	1
11	Marking of way out	5	4
Average number of rescue		4.18	3.63

**Table 6** Results of regulatory analysis of passive protection system in Likert scale

No.	Reviews	Likert scale	
		RSUP	GUM
1	Couples of fireproof construction	4	5
2	Fireproof doors and windows	2	5
3	Interior coating material	5	5
4	Barrier of fire	1	1
5	Partition the smoke barrier	1	1
6	Smoke barrier	1	1
7	Atrium	5	3
The average number of passive protection systems		2.71	3.0

Implementation of the rescue regulations as shown in Table 5 resulted in the average number of regulations applied for 4.18 for NTB Provincial general (RSUP) hospital and 3.63 for the reliability of Graha Ultima Medika (GUM) hospital in Likert scale, while the application of passive protection system regulation as in Table 6 resulted in an average amount - average of 2.71 and 3.00 in Likert scale. This shows the means of rescue at NTB RSUP hospital in accordance with the regulations, while in GUM hospital is quite in accordance with existing regulations, meanwhile, based on passive protection system, NTB RSUP hospital and GUM hospital is quite in accordance with regulations. Thus, it can be concluded that related to fire protection system with rescue component, RSUP hospital is better than GUM hospital. While based on the above results, indicating that the passive protection system in hospital GUM is better than hospital RSUP.

Based on the result of calculating reliability[11] value for each utility component, it can be concluded as shown in table 7:

**Table 7** Results of utility component assessment

No.	Utility component	Value		Maximum value
		RSUP	GUM	
1	Safety facility	23.65	23.53	25
2	Passive protection system	16.54	15.72	26
3	Tread completeness	18.78	15.93	25
4	Active protection system	14.29	12.64	24
		73.27	67.82	100

The result of calculation of utility component valuation resulted in 73.27% of system building safety[10] value (NKSKB) for RSUP and 67.82% for GUM, it shows that the reliability value of hospitals building of RSUP and GUM is in good enough category with its reliability value is still below 80%.

#### 4. CONCLUSIONS

From the results of analysis and observation in the field, it can be concluded that the application of rescue regulation in RSUP generates the average value of 4.18 in the Likert scale, while the application of passive protection system produces an average value of 2.71. This indicates that the rescue facilities at RSUP are in accordance with the regulations, while the application of passive protection system is sufficiently in accordance with the regulations. Implementation of the rescue facility regulations in GUM hospitals, in Likert scale, results in an average number of applicable regulations of 3.63, while the application of passive protection system produces an average value of 3.0. It indicates that the application of rescue facilities and passive protection systems at GUM hospitals is sufficient in accordance with existing regulations. Based on the above assessment results, it can be concluded that the application of the rules of rescue facilities and passive protection system at RSUP better than at GUM.

#### REFERENCES

- [1] Undang-Undang Republik Indonesia nomor 28 Tahun 2002 tentang Bangunan Gedung, Jakarta, 2002.
- [2] Ramli, S., Sistem manajemen keselamatan dan kesehatan kerja OHSAS 18001, Dian Rakyat, Jakarta, 2010.
- [3] Triyono, A. Teknik penanggulangan bahaya kebakaran di perusahaan, Majalah Hiperkes dan Kesehatan Kerja, 34(3), 2001, pp. 20-27.
- [4] <http://www.nfpa.org/about-nfpa>
- [5] Badan Litbang PU Departemen Pekerjaan Umum Pd-T-11-2005-C, Pemeriksaan Keselamatan Kebakaran Bangunan Gedung, Jakarta, 2005.
- [6] Saptaria dan Erry, Pedoman Teknis Pemeriksaan Keselamatan Kebakaran Bangunan Gedung, Puslitbang Permukiman, Badan Penelitian dan Pengembangan PU, Departemen Pekerjaan Umum, Bandung, 2005.
- [7] Sugiyono, Metode Penelitian Kuantitatif, Alfabeta, Bandung, 2009.
- [8] Peraturan Menteri Pekerjaan Umum No. 26/PRT/M/2008, tentang Persyaratan Teknis Sistem Proteksi Kebakaran pada Bangunan Gedung dan Lingkungan, Jakarta, 2008.

- [9] Christopher T. Mgonja, The Effects of ARC Welding Hazards to Welders and People Surrounding The Welding Area, *International Journal of Mechanical Engineering and Technology*, 8(3), 2017, pp. 433–441.
- [10] Smita B. Garde, Prof. S.L.Kotgire, Coalmine Safety System with Zigbee Specification. *International Journal of Electronics and Communication Engineering & Technology (IJECEET)*, 4(2), 2013, pp. 504–512.
- [11] Mohd Abdul Lateef, Syed Maqdoom Ali, Dr. Sardar Ali, Reactive Power Aspects in Reliability Assessment of Power Systems. *International Journal of Advanced Research in Engineering and Technology (IJARET)*,4(3), 2013, pp. 124–131.